DG Flugzeugbau GmbH 76646 Bruchsal	Technical note No. 1000/18	page 1 from 1
Subject :	Manual revision, checks and changes	
Effectivity :	DG-1000S, DG-1000T, instruction 1 - 4 all ser. No.'s, instruction are installed, , instruction 6 if equipment is mounted on the can	
Accomplishment :	Until the next annual inspection, latest until July 31.2011	
Reason	 Corrections and new findings due to operational experience and especially a) flight manual: increased recommended winch launch speed, the fin ballast box, possibility for extremely light pilots to re(only DG-1000S) and in addition for the DG-1000T: new recommended oils, a instructions for flight with engine removed and instructions of battery box locking bow, ELT and transponder installation. b) Maintenance manual: Check of rubber rings in fin ballast box of canopy opening handles, batteries and connector plugs an equipment at canopies. c) New repair manual with latest list of available materials. 	weak links, check of move the fin battery dditional concerning the fin x, check of friction
Instructions :	1. Revision of flight and maintenance manual: Exchange the following manual pages against new pages issued marked with TN1000/18 and diagrams and enclosures. Respect in the right hand margin. DG-1000S: Flight manual: $0.2 \div 0.5$, 1.4 , 1.5 , 2.9 , 2.10 , 4.3 , 4.5 , 4.6 , 4.8 , 4.6 , 11 , 7.1 , 7.2 , 7.8 , 7.10 , 7.12 , 7.13 , 9.7 , 9.13 Maintenance manual: $0.2 \div 0.12$, 1.2 , 1.5 , 1.11 , 1.14 , 1.15 , 1.18 4.8, 5.1 , 6.2 , 6.4 , diagr. 1, diagr. 9, encl. 1 pages 1, 2 , $2a$, 4 , 8 , $12193, remove 5EP50DG-1000T:Flight manual: 0.2 \div 06, 1.4, 2.6, 2.11, 2.12, 4.3, 4.5 - 4.7, 4.9, 4.29, 6.3, 6.5, 6.6, 6.10, 6.11, 7.2, 7.9, 7.12, 7.18, 7.21, 7.23, 7.Maintenance manual: 0.2, 0.4 \div 0.9, 0.9a, 0.10 \div 0.12, 1.2, 1.28, 1.29, 1.33, 2.1, 2.4 - 2.6, 3.3, 4.8, 5.1, 6.1, 6.2, 6.4, 8.3encl. 4 pages 1, 2, 2a, 3, SI 67-09, Z193, remove 5EP502. Repair manual:The existing repair manuals of variants DG-1000S and DG-1000exchanged against the new repair manual DG-1000 issued Deco3. Check of rubber rings in fin ballast box according to MM snew rings if necessary.4. Check of friction of canopy opening handles according toadjust if necessary5. Tighten screwed joints of wires in BSK12 plugs and secureaccording to MM section 1.12 (DG-1000S) or 1.15 (DG-1000T6. If equipment is mounted on the canopies check if the instalto MM section 6 last passage. If necessary change the installation$	the changes marked $.9, 4.12, 6.3 \div 6.6,$ $.8, 2.1, 2.4 \div 2.6, 3.3,$.0E3, SI 67-09, 4.10, 4.13, 4.14, 24, 9.7, 9.13 1.5, 1.14, 1.15, 1.27, , 9.2, diagr. 1, 9, 11, .00T must be ember 2010 section 1.9.4. Glue in MM section 2.2 B, .0000 with securing paint .0000 must be .0000 must be
Material	Manual pages see instruction 1 and repair manual DG-1000 issues securing paint	ued December 2010,
Weight and balance	influence negligible	
Remarks : Bruchsal, date: March 29. 2011	Instructions may be executed by the pilot/owner himself and ar entered in the aircraft logs by a licensed inspector at latest with inspection.	
Author: W. Dirks Willelm Och	Modifications approved by EASA Date 13.05.2011 under Approval No. 10034923	