Glaser-Dirks Flugzeugbau GmbH

Im Schollengarten 19-20, 7520 Bruchsaf 4
Telefon 0 72 57/89-0, Telex 7822410 GLDG
LBA anerkannter Herstellungsbetrieb IB 25
LBA anerkannter Luftfahrtlechnischer Betrieb IIA 278

SERVICE - INFORMATION NO. 0-4/92

Page 1 from 1

SUBJECT

: Control quick connectors type "Hotellier" /

securing sleeves

EFFECTIVITY

: DG-400, DG-200, DG-100

ACCOMPLISHMENT


. . .

REASON

: Securing the airbrake "Hotellier" connectors with spring pins is uncomfortable, therefore securing with sleeves is now certified.

INSTRUCTIONS

: 1. Instead of the spring pins securing sleeves S 26 may be pushed over the air-brake quick connectors and secured by strings to the pushrods, see sketch.

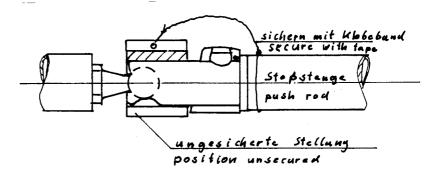

2. For connecting or disconnecting the airbrake control the sleeve must be rotated to make free the opening for the rotule. After engaging the "Hotellier" connectors the sleeve must be rotated 180° to close the opening.

Warning: Despite the securing sleeve the correct locking of the "Hotellier" connectors must be checked. The hole for the spring pin in the sliding latch must be visible.

3. The securing sleeves must be replaced every two years to provide adequate clamping force.

MATERIAL

: 2 items securing sleeve S 26 with string.

WEIGHT AND BALANCE

: no effect

Issued: Nov. 30th, 1992 April 7th, 1993